

25X1  
25X1  
25X1  
25X1

CLASSIFICATION ~~RESTRICTED~~  
CENTRAL INTELLIGENCE AGENCY

MAY 11 1954

COUNTRY USSR  
SUBJECT Economic; Technological - Machine tools, tools  
HOW PUBLISHED Monthly periodical  
WHERE PUBLISHED Moscow  
DATE PUBLISHED Oct 1951  
LANGUAGE Russian

DATE DIST. 14 Apr 1953

NO. OF PAGES 3

SUPPLEMENT TO  
REPORT NO.

THIS DOCUMENT CONTAINS INFORMATION AFFECTING THE NATIONAL DEFENSE  
OF THE UNITED STATES WITHIN THE MEANING OF ESPIONAGE ACT 50  
U. S. C. 31 AND 32, AS AMENDED. ITS TRANSMISSION OR THE REVELATION  
OF ITS CONTENTS IN ANY MANNER TO AN UNAUTHORIZED PERSON IS PRO-  
HIBITED BY LAW. REPRODUCTION OF THIS FORM IS PROHIBITED.

THIS IS UNEVALUATED INFORMATION

25X1

SOLDERS FOR JOINING BLADES TO TOOL SHANKS

S. A. Narskiy

Solders for joining high-speed steel blades to shanks made of carbon steel or iron as a rule must have a melting point close to the hardening temperature of high-speed steel. The use of solders whose melting point is higher than 1,300 degrees centigrade is not recommended since the edges of the cutting blades would melt.

The utilization of solders with a melting point of 20-40 degrees below the hardening temperature of high-speed steels permits soldering with simultaneous air hardening of the tool.

In addition, with the utilization of these solders, the tool can be heated twice (for soldering and hardening). This is done if there is insufficient air cooling during soldering or if soldering is done with repeated heating (multi-blade mills). The high-speed steel blades are then inserted and secured to the shank of the tool.

During hardening, the solders are held in place between the blades and shank by capillary force. There is less flowability as compared to the initial state because during soldering, the composition of the solder becomes more refractory as a result of the diffusion of iron in the connecting parts.

At present, high-speed steels are soldered with GPF and GFK solders. The composition of these solders is given in the following table:

Name of Solder	Copper	Nickel	Iron	Manganese	Ceramics	Zinc	Melting point (degrees centigrade)
GPF	66-72	10-14	12-14	4.2-5.0	1.0-1.8	--	1,180-1,280
GFK	74	4.0	6.0	4.5	4.0	7.5	1,150

- 1 -

CLASSIFICATION

STATE	<input checked="" type="checkbox"/> NAVY	<input checked="" type="checkbox"/> NSRB	DISTRIBUTION																
ARMY	<input checked="" type="checkbox"/> AIR	<input checked="" type="checkbox"/> FBI																	

25X1

25X1

The melting point of GPF solder can be changed by changing the percentage of the different elements.

In special cases, welding powders are used for soldering high-speed steel blades. They are composed of ferromanganese, ferrosilicon, or mixtures of them. Frequently, fluxes such as ground glass and borax are added to their composition:

Composition of Welding Powders, in %

<u>Ferro-</u> <u>manganese</u>	<u>Ferro-</u> <u>silicon</u>	<u>Steel</u> <u>Chips</u>	<u>Iron</u> <u>Chips</u>	<u>Copper</u> <u>Chips</u>	<u>Ground</u> <u>Glass</u>	<u>Dehy-</u> <u>drated</u> <u>Borax</u>	<u>Commer-</u> <u>cial</u> <u>Soda</u>	<u>Melting Point,</u> <u>(degrees centigrade)</u>
60	--	--	--	--	30	10	--	1,300-1,320
80	--	--	--	20	--	--	--	1,160-1,180
75	--	--	--	25	--	--	--	1,160-1,180
--	32	10	--	16	--	32	10	1,250-1,280
40	10	--	20	5	15	10	--	1,190-1,300

The effectiveness of these powders differs little from that of solders. However, since they have less flowability as compared with ordinary solders, they have little resistance to bending stresses. For this reason, they are used for the most part on single-blade tools.

Hard metal-ceramic (powder-metallurgy) alloys do not require any heat treatment and can, without detriment to the cutting properties, be heated during soldering to 1,100-1,150 degrees centigrade. Only in heating special titanium-carbide alloys to very high temperatures can fractures occur.

The basic requirements for solder for hard alloys are as follows:

- 1 The solder must have a melting temperature of from 900 to 1,100 degrees centigrade.
- 2 In addition to high mechanical strength, the solder must have high plastic properties.

Among the solders used for soldering hard alloys, the best are copper-nickel alloys, electrolytic copper, brasses with nickel added, and pure brasses. The composition of these solders is shown in the following table.

Composition, in %

<u>Name of</u> <u>Solder</u>	<u>Copper</u>	<u>Nickel</u>	<u>Zinc</u>	<u>Lead</u>	<u>Manga-</u> <u>nese</u>	<u>Aluminum</u>	<u>Melting Temperature,</u> <u>(degrees centigrade)</u>
Copper-nickel- zinc	66-68	26-28	3.0	--	--	0.8-1.0	1,100-1,150
Copper-nickel- zinc	85-87	8-10	3.0	--	--	0.8-2.0	1,020
VNIIS	90	3	--	--	2	5	1,100-1,150
KM	58-60	8-9	3.0-3.2	1-2	--	--	950-980

25X1

Composition, in %

<u>Name of Solder</u>	<u>Copper</u>	<u>Nickel</u>	<u>Zinc</u>	<u>Lead</u>	<u>Manga- nese</u>	<u>Aluminum</u>	<u>Melting Temperature (degrees centigrade)</u>
PMTs 52 (GOST 1534-42)	49-53	--	47-51	--	--	--	876
PMTs 47 (GOST 1534-42)	45-49	--	51-55	--	--	--	860
Electrolytic copper	99.9	--	--	--	--	--	1,083

The first three solders can be used for all hard alloys in tools operating under a big load. If the hard-alloy blades become fractured in soldering, or in the process of grinding or lapping, it is recommended that KM solder, which has a lower melting point, be used.

For tools operating under a small load (drills up to 15 millimeters in diameter and small cutting tools), solders (PMTs-52 and PMU-47) which have a lower melting point can be used in the form of a foil.

The use of electrolytic copper under conditions of heating without a reducing atmosphere is not recommended because the soldering process takes place at a temperature of 1,120-1,150 degrees centigrade and leads to the intensive oxidation of the solder, thus lowering the strength of the joint.

- E N D -

- 3 -